



SERVICE BULLETIN

Classification: BT95-007	Reference: NTB95-083	Date: September 6, 1995
-----------------------------	-------------------------	----------------------------

1995-1996 MAXIMA CENTER CONSOLE LID LATCH REPLACEMENT


APPLIED VEHICLE(S): 1995-1996 Maxima (A32)

SERVICE INFORMATION

If a customer complains that the center console lid will not latch properly, this may be caused by a cracked or broken latch. An improved latch is now available separately, making replacement of the entire lid assembly for a broken latch no longer necessary. This new latch mounts to the console lid in the same manner as is currently used, and will fit any 1995-1996 Maxima.

SERVICE PROCEDURE

1. Open console lid.
2. Remove the two latch mounting screws and detach broken latch.
3. Install new latch using the existing screws.

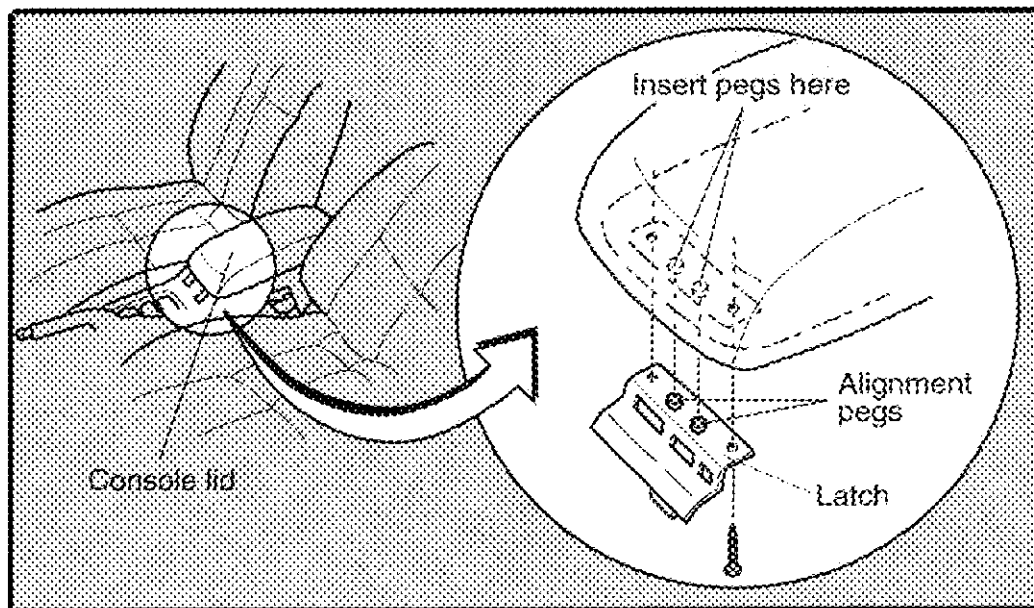

4. Check the alignment of the new latch by closing the console lid.
5. Align the lid by slightly loosening the hinge screws and adjusting as needed.
6. Verify the alignment is OK and tighten the screws at the hinge. The lid should open and close easily without binding.

PARTS INFORMATION

DESCRIPTION	PART #/PFP	QUANTITY
Lock-Console	96928-40U01	1

CLAIMS INFORMATION

OPERATION	OP CODE	PNC	SYMPTOM	DIAGNOSIS	FRT
LOCK-CONSOLE	VD30AA	96928	FB	01	0.2 hrs

NOTE:

1. New Claims System dealers: Submit a Primary Part claim using P/N 96928-40U01.