



# SERVICE BULLETIN

Classification: MT95-002	Reference: NTB95-091	Date: September 20, 1995
-----------------------------	-------------------------	-----------------------------

## 1995 MAXIMA CLUTCH SLIP

**APPLIED VEHICLE(S):** 1995 Maxima (A32)  
**APPLIED DATE(S):** 3/16/95

### SERVICE INFORMATION

Some 1995 Maxima manual transmission customers may experience clutch slipping. The incident may occur on hard acceleration in 4th or 5th gear.

**To correct this incident the material for the clutch disc has been changed to help prevent clutch slipping.**

### SERVICE PROCEDURE

Verify that the vehicle exhibits clutch slipping on hard acceleration in 4th or 5th gear. If clutch slipping occurs:

- Replace the clutch disc with the countermeasure disc (part no. 30100-40U11).
- Inspect the clutch cover and flywheel for visible signs of wear and/or heat discoloration.
- Replace the clutch cover only if signs of wear and/or heat discoloration are visible.

Refer to the CL section of the 1995 Maxima Service Manual for additional service information.

### PARTS INFORMATION

DESCRIPTION	PART #/PFP	QUANTITY
Clutch Disc	30100-40U11	1
Clutch Cover	30210-40U03	1

### CLAIMS INFORMATION

OPERATION	OP CODE	PNC *	SYMPTOM	DIAGNOSIS	FRT
RPL CLUTCH COVER / DISC ASSY'S	HB10AA	30100	ZF	24	4.0 HRS

Note \*: New Claims System dealers should submit a Primary Part claim P/N 30100-40U11.