



SERVICE BULLETIN

Classification: BT97-008a	Reference: NTB97-046a	Date: November 1, 1997
------------------------------	--------------------------	---------------------------

1995-97 MAXIMA POWER SEAT LIFT MOTOR OUTPUT GEAR STRIPPED

APPLIED VEHICLE: 1995 through early 1997 Maxima (A32)
APPLIED VIN(S): Vehicles built before JN1CA21D*VT807898,
JN1CA21D*VT202921 and JN1CA21D*VM501784
APPLIED DATE: Vehicles built before August 3, 1996

SERVICE INFORMATION

If the power seat lift adjustment on a 1995, 1996 or early 1997 Maxima is not working, the plastic output gear of the lift motor may be stripped.

Use the information in this bulletin to diagnose and repair this incident.

A countermeasure adjuster assembly and finisher assembly are available to address this incident.

SERVICE PROCEDURE

1. To verify this condition, operate the lift switch while sitting in the seat.
2. Listen for the motor operation and watch the seat for a change in height.
3. If there is no seat movement, remove the motor from the seat frame and inspect the plastic gear (see Figure 1, page 2).
4. If the plastic gear is stripped, use the procedures in the BT section of the service manual to replace the adjuster assembly and finisher assembly with the countermeasure parts.

Individual countermeasure parts are not interchangeable - replace them as a set only.

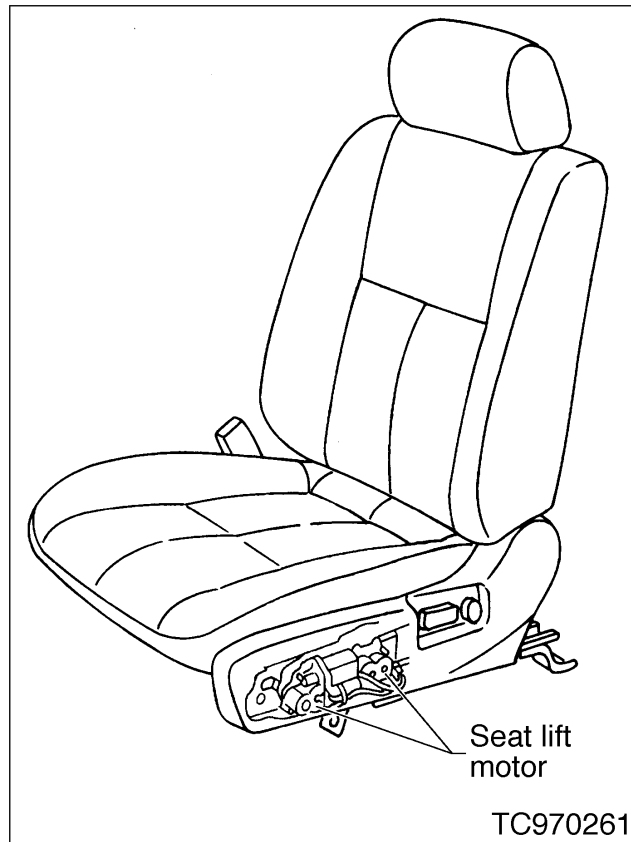


Figure 1

PARTS INFORMATION

DESCRIPTION	PART #/PFP	QUANTITY
Adjuster assembly, front seat LH	87450-49U40	1
Finisher assembly - cushion front outer LH	87380-49U23	1
beige	87380-49U22	
serene	87380-49U21	
black	87380-49U20	

CLAIMS INFORMATION

When applicable, standard claims coding applies.