



# SERVICE BULLETIN

Classification: BT97-031	Reference: NTB97-099	Date: February 1, 1998
-----------------------------	-------------------------	---------------------------

## 1995-98 MAXIMA SUNROOF WATER LEAKS DUE TO REAR DRAIN TRAY GUIDE

**APPLIED VEHICLE:** All 1995-98 Maxima (A32)

### SERVICE INFORMATION

If a 1995-98 Maxima exhibits sunroof water leaks, the cause may be an improperly positioned sunroof rear drain tray that may be from broken drain tray guide(s).

Drain tray guides are available separately and do not require the purchase of the entire sunroof frame.

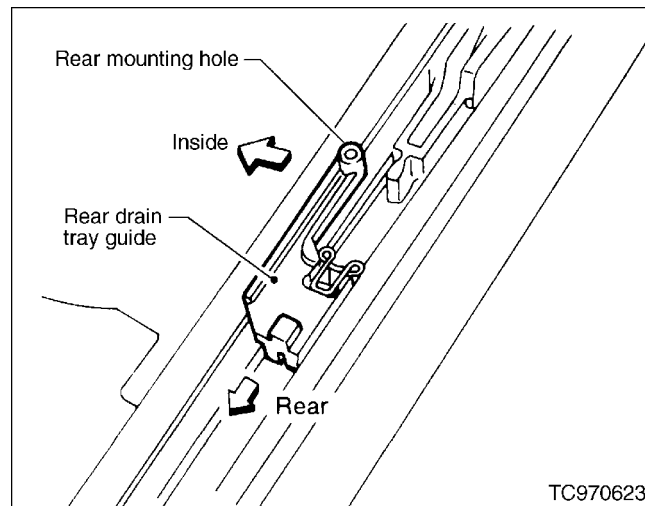


Figure 1

### SERVICE PROCEDURE

Replace drain tray guide(s) according to service procedures outlined in the appropriate service manual:

- For 1995 Maxima, see pages BF-33 through BF-35 of the 1995 Maxima Service Manual.
- For 1996 Maxima, see pages BT-28 through BT-30 of the 1996 Maxima Service Manual.
- For 1997 Maxima, see pages BT-32 through BT-34 of the 1997 Maxima Service Manual.
- For 1998 Maxima, see pages BT-34 through BT-36 of the 1998 Maxima Service Manual.

**PARTS INFORMATION**

<b>DESCRIPTION</b>	<b>PART NUMBER</b>	<b>QUANTITY</b>
Rear Drain Tray Guide (RH)	K1353-01U10	1
Rear Drain Tray Guide (LH)	K1354-01U10	1

**CLAIMS INFORMATION**

When applicable, standard claims coding applies.