



SERVICE BULLETIN

Classification: BT95-012	Reference: NTB95-008	Date: January 25, 1995
-----------------------------	-------------------------	---------------------------

1995 MAXIMA SPARE TIRE COVER RATTLE NOISE

APPLIED VEHICLE(S): 1995 Maxima (A32)

SERVICE INFORMATION

If an owner of a 1995 Maxima complains of a rattle type noise from the rear of the vehicle allegedly caused by the spare tire cover contacting the floor of the trunk, confirm the incident by removing the spare tire cover and test driving the vehicle.

SERVICE PROCEDURE

1. Remove the three (3) pieces of the foam tape originally installed on the bottom of the spare tire cover (figure 1).

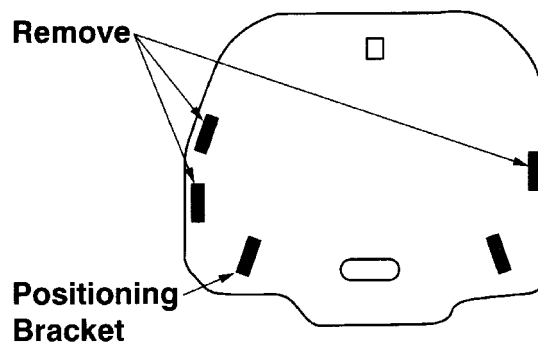


Figure 1

2. Install foam tape around all edges of the spare tire cover except the edge below the handle opening (figure 2).

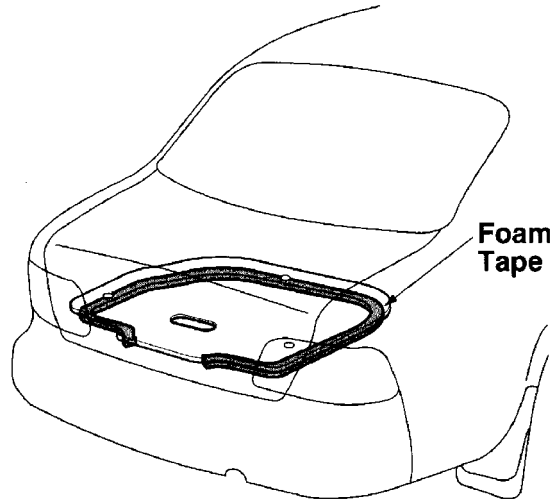


Figure 2

PARTS INFORMATION

Foam tape to be used is 3M SCOTCHFOAM Black Vinyl Foam Tape. Tape can be purchased from 3M as part number 06370, tape No. 4504 Size: 3/4 in. Contact your local 3M representative or call 1(800) 521-8180 extension 6890 for the number of the nearest distributor.

CLAIMS INFORMATION

OPERATION	OP CODE	PNC	SYMPTOM	DIAGNOSIS	FRT
Adjust/Replace Spare Tire Holdown	UF22AA	74630	ZL	41	0.2 hrs

NOTE: Do not claim the foam tape. Sufficient labor time is allowed to cover the miniscule cost of the portion of the tape roll utilized for this repair.